


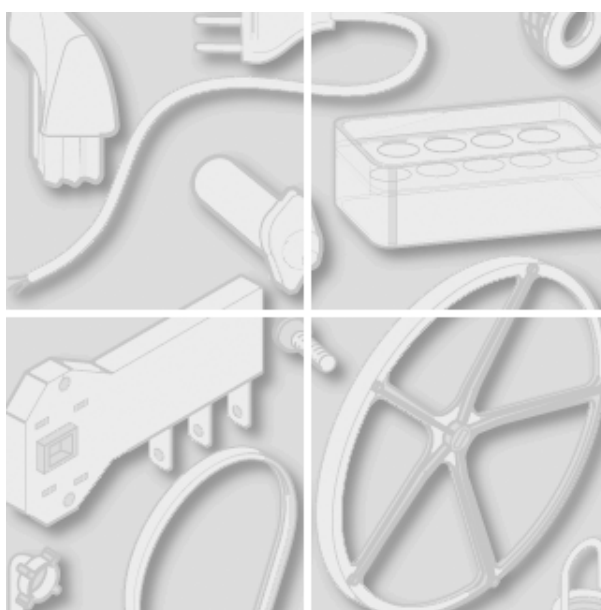

Modèle:
IDVA735FR

Code commercial:
F062967

Notes générales

Comment utiliser la documentation technique

Vous trouverez ici quelques informations générale pour simplifier la consultation de la documentation technique:


1. Les modèles d'une même gamme utilisent les mêmes vues éclatées. De ce fait un modèle ne comporte pas obligatoirement tous les repères présents sur les vues éclatées.
2. Certaines pièces détachées ne sont pas dessinées sur les vues éclatées (livrets d'instructions, kit spécifiques,...). Vous trouverez les codes dans la liste de pièces détachées sous le repère 099 ou 999. Les livrets d'instructions sont en repère 000.
3. En haut à droite de chaque vue éclatée, le numéro de série indique le début de production de la gamme. Certains modèles comportent plusieurs vues éclatées avec des numéros de série différents. Dans ce cas, le numéro de série figurant sur l'appareil est nécessaire pour identifier la pièces détachée correcte.
4. Les vues éclatées peuvent avoir des mises à jour ultérieures après publication. Les nouvelles pièces détachées figurent alors sur cette nouvelle version. Le numéro de mise à jour se retrouve dans les quatre derniers chiffre du numéro de série en haut à droite de la vue éclatée.
5. La liste de pièces détachées d'une vue éclatée comporte les codes SAV du modèle. Ces codes comportent d'autres informations:

REF : Repère de la pièce sur la vue éclatée; REMPLACEMENT : liste de pièces de remplacement mais ayant les mêmes caractéristiques fonctionnelles.

CODE INDUSTRIEL: Liste des modèles sur lesquels est utilisée la pièce détachée;NOTICE TECHNIQUE: Code de la notice technique à consulter afin de prendre connaissance des modifications techniques et troiuver la bonne pièce détachée.
6. Certaines notices techniques sont générales et ne sont liées à aucune pièce détachée. Afin d'éviter toute confusion, il faut faire attention à la section notice et constamment vérifier les mises à jour de la documentation.
7. La couverture de la documentation indique le nom du modèle et son code commercial

07404-20

Vue éclatée

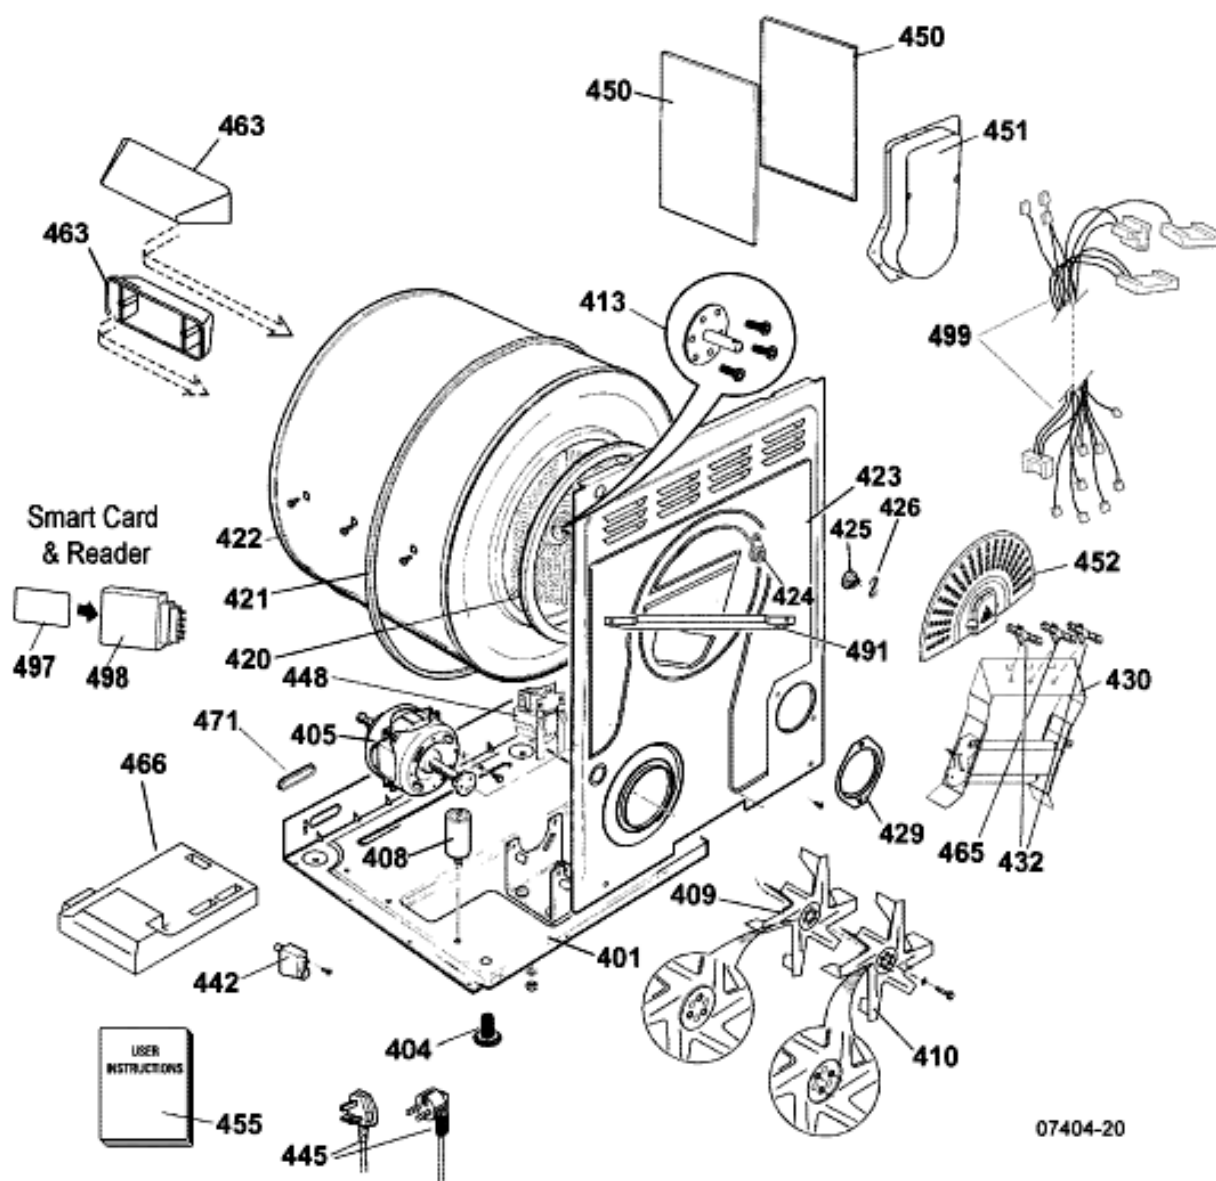

07404-20 détachées

Liste de pièces

Repè	Code SAV	De S/N	À S/N	Remplacem	Description	Notice	Code
401	C00122256 (482000080957)				vis 6x3/8		
401	C00252668 (482000084833)				etrier		
401	C00255221 (482000084944)			1 x C00292281 (482000088924)	vented base		
404	C00142439 (482000029638)				pied dryers		
404	C00193759 (482000083078)				3mm washer		
405	C00143146 (482000081942)		00816...	1 x C00282296 (482000032010)	moteur 358 imep	n4410i00	95629670000
405	C00279461 (482000087759)	00817...	20918...	1 x C00293493 (488000293493)	moteur 358 vented welling (use 9uf cap	n4410i00	95629670000
405	C00293750 (482000089046)	20919...	30828...		moteur 377/378 (9uf cap. 3 way harnes)	n4412i03	95629670000
						n4414a01	95629670100
							95629674400
							95629674500
405	C00301435	30829...		1 x C00306891 (482000089752)	moteur 387/388 (9uf cap 3 wires)	n4412i03	95629674400
						n4414a01	95629674500
408	C00194453 (482000030182)				condensateur 8 uf (iskra)	n4410i00	
						n4412j01	
408	C00279463 (482000031447)				condensateur 9uf	n4410i00	
						n4412j01	

409	C00112153 (482000079757)	ventventilateur interieur	
410	C00116327 (482000080392)	ventventilateur externe	
413	C00113038 (482000022828)	kit entretoise tambour 'is60v'	n4414f01
413	C00305794 (482000032268)	drum shaft kit (riveted drum plate)	n4414f01
420	C00379277 (482000090394)	vented (5mm rivet) rear panel serv kit	
420	C00383247 (488000383247)	vented rear panel (4mm rivet) assembly	
421	C00145707 (482000030038)	courroie h9 1860mm	
422	C00383262 (482000092715)	vented drum 4mm rivet	n4416b07
423	C00250894 (482000084802)	screw 8x1/2 pan head	
423	C00298617 (482000089387)	arrêt tambour	n4414a00
423	C00379277 (482000090394)	vented (5mm rivet) rear panel serv kit	
423	C00383247 (488000383247)	vented rear panel (4mm rivet) assembly	
424	C00142628 (482000022961)	palier arriere	
424	C00250889 (482000023027)	vis	
425	C00142631 (482000029650)	support tambour	
426	C00095551 (482000028095)	pin drive	
429	C00141697 (482000081730)	1 x C00288486 (482000031819)	joue

07404-20 détachées

Liste de pièces

Repè	Code SAV	De S/N	À S/N	Remplacem	Description	Notice	Code
430	C00257622 (482000030495)		91122...		resistance(one shot+cycling+ntc tod)	n4410j00	95629670000
430	C00277074 (482000031361)	91123...	20919...		resistance a2 2.2kw	n4410j00 n4412i03	95629670000
430	C00293567 (482000032018)	20919...			resistance vented arcadia 2.2kw	n4412i03	95629670000
							95629670100
							95629674400
							95629674500
432	C00112196 (482000028577)	40501...			thermostats (one shot+cycling) dbk	n4408a01	
432	C00262243 (482000030642)	70802...			thermostats (one shot+cycling) blaisi	n4408a01	
442	C00095556 (482000078199)			1 x C00376410 (488000376410)	passe-cable		
445	C00095999 (482000028134)			1 x C00480456 (488000480456)	cable alimentation		
448	C00122256 (482000080957)				vis 6x3/8		
448	C00301275 (482000032214)			1 x C00376427 (488000376427)	filtre antiparasites		
450	C00112184 (482000079765)				flanc phd white		
450	C00122256 (482000080957)				vis 6x3/8		
451	C00116328 (482000080393)		20918...		carter de resistance (dbk)	n4412i03	
451	C00293850	20919...			carter de resistance (dbk) arcadia	n4412i03	

452	C00118929 (482000080836)			1 x C00289203 (482000031841)	cache plastique		
463	C00141607 (482000081713)			1 x C00286905 (482000031771)	aube de tambour	n4412c01	
463	C00250835 (482000084794)				screw 5 x 23		
463	C00286905 (482000031771)				aube de tambour curved	n4412c01	
465	C00143511 (482000029780)	20918...			thermostat ntc (tod)	n4412i03	95629670000
465	C00292949 (482000031995)	20919...			thermostat ntc rear arcadia	n4412i03	95629670000
							95629670100
							95629674400
							95629674500
466	C00255835 (482000084992)		91122...	1 x C00269466 (482000030955)	module a1 + eeprom vierge' dryers'	n4410j00	95629670000
466	C00277031 (482000087507)	91123...	20918...	1 x C00280422 (482000031476)	module a2 sw4.05.08	n4410d00	95629670000
						n4410j00	
						n4412i03	
466	C00292963 (482000031996)	20919...		1 x C00303312 (482000023450)	module arcadia dryer	n4412i03	95629670000
							95629670100
							95629674400
							95629674500
471	C00255630 (482000084974)			1 x C00113889 (482000080002)	couvercle		

07404-20 détachées


Liste de pièces

Repè	Code SAV	De S/N	À S/N	Remplacem	Description	Notice	Code
491	C00122256 (482000080957)				vis 6x3/8		
491	C00260451 (482000085398)			1 x C00379317	entretoise		
497	C00274789 (482000087161)		91101...		card idva735fr 8kb 28629670000		95629670000
497	C00279479 (482000087764)	91102...	20918...		card idva735fr 8kb 28629670001	n4410d00	95629670000
497	C00294681	20919...			card idva735fr 8kb 50629670027	n4412i03	95629670000
							95629670100
							95629674400
							95629674500
499	C00199418 (482000083634)				harness display/power bd		
499	C00208227	00612...	20918...		cablage micro-retardateur j10	n4412i03	95629670000
499	C00208228 (482000084489)		20918...		cablage module to ntc	n4412i03	95629670000
499	C00293754	20919...			cablage l&n arcadia vented	n4412i03	95629670000
							95629670100
							95629674400
							95629674500
499	C00293758	20919...	30828...		cablage motor & capacitor in block	n4412i03	95629670000
							95629670100

					95629674400
					95629674500
499	C00301433	30829...		cablage motor (3 wire motor)	n4414a02
999	C00115270 (482000080247)		1 x C00296170 (482000032081)	panier rangement chaussures	
999	C00142716 (482000081873)			outil pour montage courroie dryer gda	
999	C00258633 (482000030508)			tuyau evacuat	
999	C00295636			dryer arcadia supplement	
999	C00309221			arcadia dryer fault code chart	
999	C00309339			dryer evo 2 fault codes	

07489-05

Vue éclatée

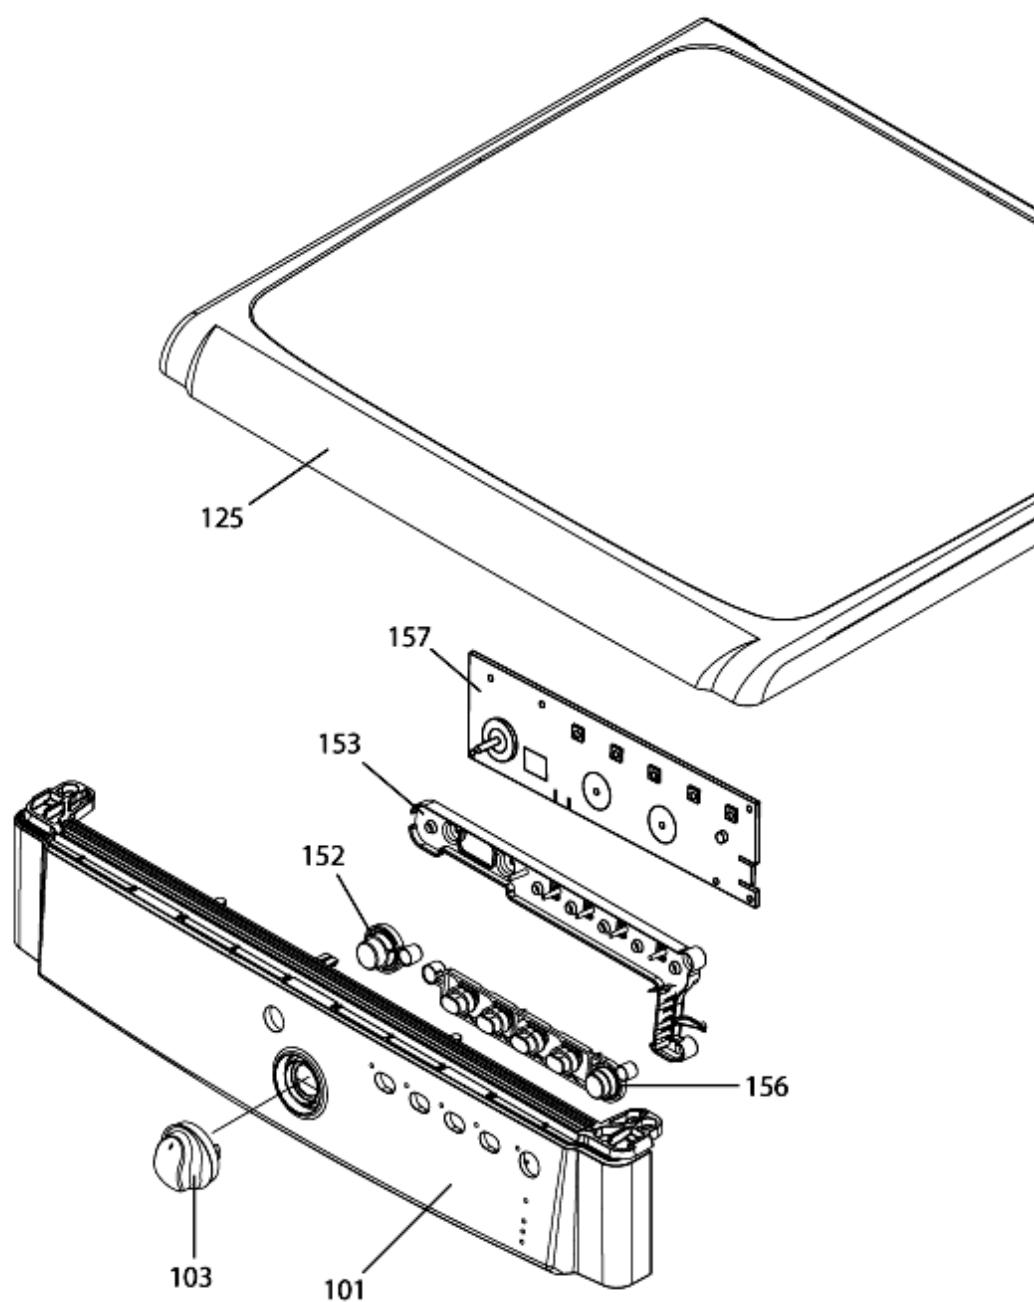

07489-05


07489-05
détachées

Liste de pièces

Repè	Code SAV	De S/N	À S/N	Remplacem	Description	Notice	Code
101	C00274174 (482000087043)				tableau de bord idva735fr	n4412107	
101	C00296554 (482000089274)	21211...	40921...	1 x C00274174 (482000087043)	tableau de bord idva735fr	n4412107	
103	C00271172 (482000023115)				bouton programmes		
125	C00116323 (482000080391)				couvercle		
152	C00306484 (482000023479)				bouton poussoir on-off blanc		
153	C00271314				ens. 5 lentilles transparent		
156	C00306486 (482000089704)				bouton option blanc		
157	C00271634 (482000086696)		91101...	1 x C00276318 (482000031314)	carte de controle	n4409j00	95629670000
157	C00276318 (482000031314)	91102...	20919...		carte de controle stand - by	n4409j00	95629670000
157	C00294628 (482000032041)	20919...	40923...	1 x C00300591 (482000089497)	boite controle display eco led	n4412i03	95629670000
						n4414j02	95629670100
							95629674400
157	C00300591 (482000089497)	40924...			boite controle display memo led	n4414j02	95629674400

07489-15

Vue éclatée

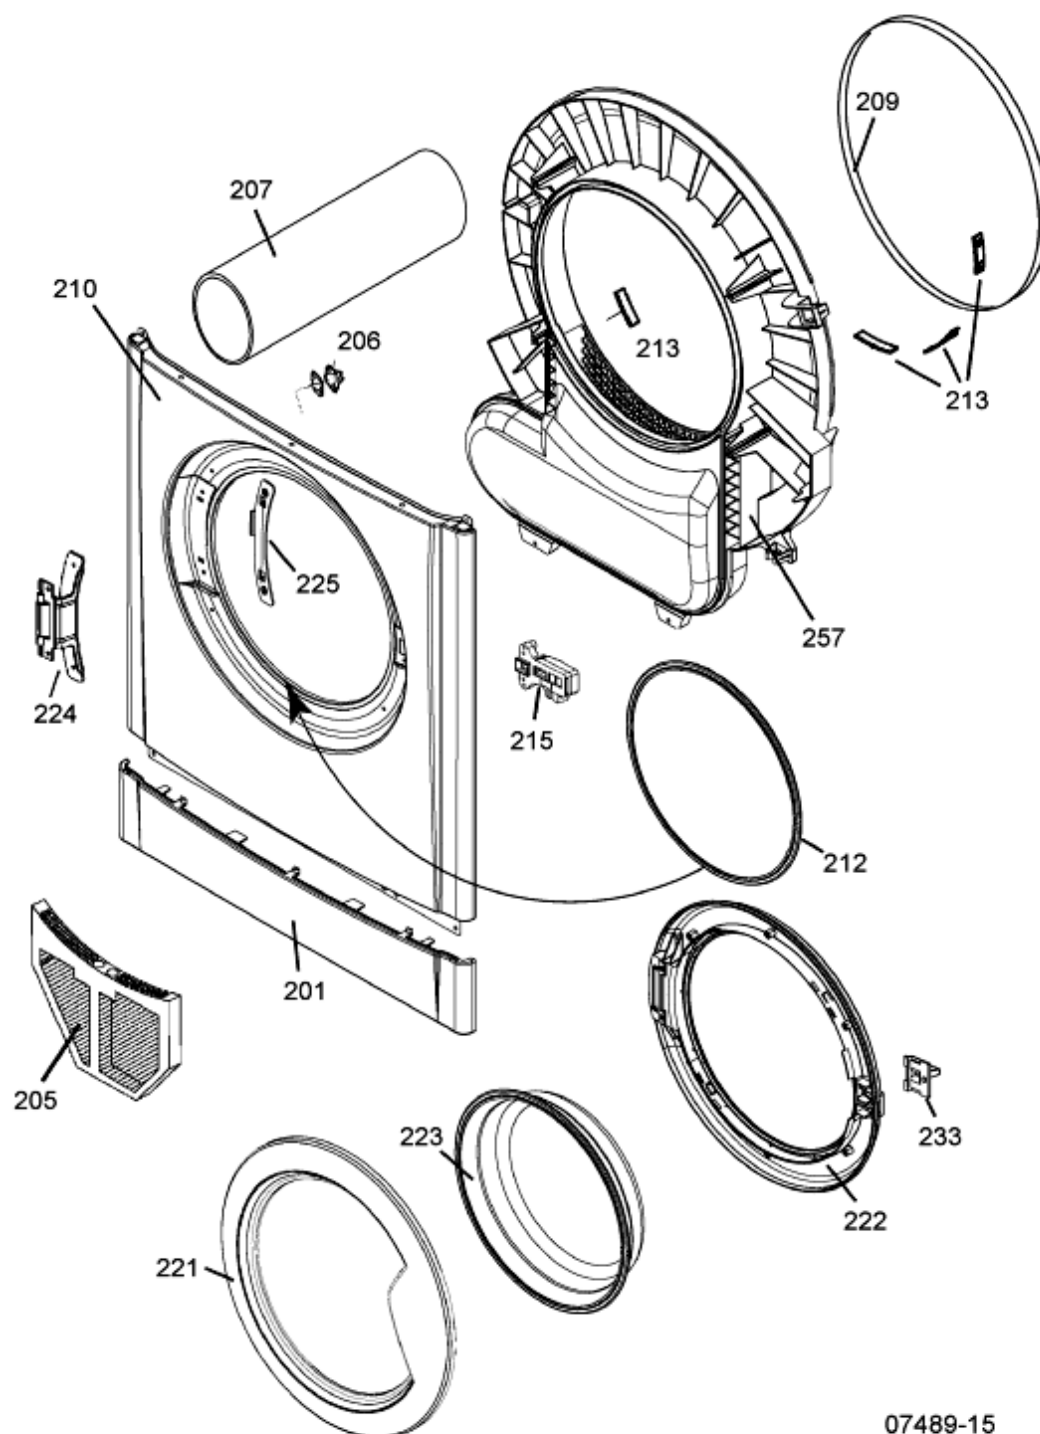

07489-15

07489-15
détachées

Liste de pièces

Repè	Code SAV	De S/N	À S/N	Remplacem	Description	Notice	Code
201	C00116319 (482000028886)				plinthe blanc indesit		
205	C00112209 (482000079777)		40714...	1 x C00207652 (482000030304)	filtre grey vented	n4411g04	
						n4414c04	
205	C00286297 (482000031728)		40714...		filtre vented white	n4411g04	
						n4414c04	
						n4414h00	
205	C00306110 (482000032270)	40715...			filtre vented	n4414h00	
206	C00142702 (482000029656)		20918...		thermostat	n4412i03	95629670000
206	C00291937 (482000023314)	20919...			thermostat arcadia td	n4412i03	95629670000
							95629670100
							95629674400
							95629674500
207	C00095624 (482000078226)				tuyau		
209	C00142613 (482000029646)		40714...		feutre 14mm	n4414c04	
						n4414h00	
209	C00276750 (482000031352)		40714...		feutre 16mm vented	n4409k00	
209	C00288108 (482000088513)	40715...			feutre vented m2	n4414h00	

210	C00122256 (482000080957)		vis 6x3/8		
210	C00142144 (482000081791)		panneau avant blanc		
210	C00252668 (482000084833)		etrier		
212	C00112211 (482000028579)		joint hublot vented grey	n4411g01	
212	C00286379 (482000088341)	1 x C00112211 (482000028579)	joint blanc	n4411g01	
213	C00112144 (482000028572)	40714...	tampon palier	n4414h00	
213	C00287118 (482000031778)	40715...	tampon palier m2	n4414h00	
215	C00141694 (482000022953)	20918...	fermeture porte (electronic/relay)	n4412i03	95629670000
215	C00291938 (482000023315)	20919...	fermeture porte arcadia td	n4412i03	95629670000
					95629670100
					95629674400
					95629674500
221	C00268982 (482000086358)		cadre de hublot white		
222	C00116336 (482000028888)		contre cadre hublot 'is60v'		
223	C00112192 (482000028576)		verre hublot 'as60vex'		
224	C00095987 (482000078274)	1 x C00075325 (482000070083)	charniere hublot		
225	C00112277 (482000079795)		plaquette charniere		
233	C00142619 (482000029649)		crochet porte		

07489-15
détachées

Liste de pièces

Repè	Code SAV	De S/N	À S/N	Remplacem	Description	Notice	Code
257	C00261899 (482000085533)	80317...	00106...	1 x C00278295 (482000087635)	conduit air	n4409k00	
257	C00270532 (482000030991)				bande capteur vented		
257	C00278295 (482000087635)	00107...	40714...	1 x C00288738 (482000031828)	conduit air gris 14mm seal rib	n4409k00	
						n4411g06	
						n4414c04	
257	C00286597 (482000088364)	00107...	40714...		conduit air blanc	n4411g06	
						n4414c04	
						n4414h00	
257	C00306098 (482000089691)	40715...			conduit air blanc	n4414h00	

Notices

n4408a01: VENTED TUMBLE DRYER HEATERS

From Serial Number 70802.0001, Two different Heater manufacturers were used in production. These DBK and Blaisi Heaters are totally interchangeable if replaced as an assembly.

But the thermostat kits for these Heaters are not interchangeable.

From Serial number 70802.0001, before a Stat. Kit is replaced the heater fitted to the machine must be identified first.

DBK heaters and covers are used as service spares.

Heater Identification

The DBK heater element wire is in a Flat Strip.

The Blasi heater element wire is Circular and There is a Blaisi Label on the Heater

For the Dryer to work correctly the correct Heater and Stat. Kit must always be fitted.

See "Parts List" to select required part.

n4409a00: DRUM SHAFT

Two Drums have been used in production.

Inspect the machine to see which type of drum shaft fixing is fitted.

1 has a drum shaft which is screwed and the shaft only can be replaced if required.

1 has a drum shaft which is fixed and the shaft can not be replaced, if damaged the complete drum assembly will be required.

n4409j00: ELECTRONIC DRYERS INTRODUCTION OF STAND-BY MODE

Beginning the 1st week in November, a new Control/Interface Module will be used in production.

This new Module incorporates Stand-by. Stand-by mode activates 30 minutes after the machine has finished its drying cycle, if the machine is still "on"

See List for required part.

n4410d00: Settings file for 'Stand-By'

With the introduction of Stand – By from 2/11/09 (091102.0001) Indesit FMD & some Aqualtis models were given a new settings file to rev. 01*. This will have an affect when replacing the electronic interface card and control module.

Service replacement of the electronic interface card will be of the Stand – By version

When replacing a control module or electronic interface card to a model manufactured before 091102.0001 use settings file rev.00.* Stand – By is not affective.

When replacing a control module or electronic interface card to a model manufactured from 091102.0001 uses settings file rev.01.* Stand – By is affective.

Two versions of control module are used on this product identified as A1 & A2, all models produced with the A2 module are fitted with the Stand – By version of electronic interface card and settings file Re. 01*

*Model AQCF851BUFR - 61408 settings file changes from rev.01. to 02.

See notice n4409k02 for further information on control the module

n4410i00: Introduction du moteur of Welling Type 358

A partir du 17/08/2010, numéro de série 00817.0001, introduction en production du moteur type 358 fabriqué par Welling. Ce moteur utilise un condensateur de 9µf.

Le moteur Welling 358 peut être utilise en lieu et place du moteur type 358 fabriqué par IMEP, mails il convient d'y ajouter le condensateur 9µf.

Depuis décembre 2010, seul le moteur Welling est géré en SAV.

CONDENSATEURS

Sur le production avec moteurs Ana Imep, les condensateurs suivants ont été utilisés :

- 7.5 uf (produits 6 kg);
- 8.0 uf (produits 7 kg);
- 9 uf (produits 7,5 kg).

Tous les appareils équipés d'un moteur Ana Imep peuvent utiliser le condensateur 9uf.

Les moteurs Welling 358 ne doivent être équipés que du condensateur 9uf.

LES DEUX MOTEURS SONT INTERCHANGEABLES EN UTILISANT LE CONDENSATEUR APPROPRIE.


n4410j00: Modification Module A2 et résistance/ modification BBC

Introduction Module et résistance A2 :

Durant la semaine commençant le 23/11/2009, s/n 911230001, un nouveau module de puissance et résistance A2 ont été mis en production. Cependant la modification a été introduit graduellement à partir de la date ci-dessus jusqu'à 02/01/2010, s/n 001020001. Durant cette période, le module et résistance mis en production peuvent varier entre l'original et le nouveau type A2, cela dépend de la disponibilité des composants à l'époque. Pour identifier facilement les modèles produits pendant cette période, avec utilisation du module et résistance A2, un autocollant BLEU a été mis sur l'arrière de la machine à coté de la plaquette (voir image joint). A partir du 02/01/2010 tous les modèles ont été équipés du nouveau module et résistance A2, donc plus d'autocollant bleu à partir de cette date.

Modification dans la fabrication des modèles classe énergétique « B » à partir du 16/08/10 (connus sous le nom BBC)

A partir du 16/08/2010, s/n 08160001, la fabrication de quelques modèles de sèche linges 7 kg, 7.5 kg et 8 kg avec classe énergétique niveau 2 et 3B a évolué vers un nouvelle fabrication classe énergétique B, utilisant un module de contrôle firmware avec 4.5.14 ainsi qu'un nouveau type de moteur 632 et un kit résistance 2.3 KW. Le châssis est basé sur l'Aqualtis classe B mais avec un condenseur de type C avec le conduit de base et les capots moteur enlevés.



n4411g01: VENTED DOOR SEALS

ON SELECTED TUMBLE DRYERS FROM JUNE 2011 THE DOOR SEAL COLOUR CHANGED FROM GREY TO WHITE. SELECTED THE CORRECT PART BY DESCRIPTION IN THE PARTS LIST

FROM MAY 2014 STOCK OF THE WHITE SEALS HAS BEEN EXHAUSTED SO ONLY GREY NOW AVAILABLE. THE WHITE SEALS HAVE BEEN SUPERSEDED AS THIS IS CONSIDERED A SUITABLE ALTERNATIVE

n4411g04: COLOUR CHANGE TO THE FILTER> VENTED DRYERS

FROM JUNE 2011 THE FLUFF FILTER FITTED TO VENTED TUMBLE DRYERS CHANGED IN PRODUCTION FROM GREY TO WHITE.

SELECTED THE CORRECT PART BY DESCRIPTION IN THE PARTS LIST

n4411g06: COLOUR CHANGE TO WHITE FRONT AIR DUCT

FROM JUNE 2011 THE FRONT AIR DUCT FITTED TO VENTED TUMBLE DRYERS CHANGED IN PRODUCTION FROM GREY TO WHITE.
SELECTED THE CORRECT PART BY DESCRIPTION IN THE PARTS LIST

n4412b00: VENTED REAR PANEL

During October and November 2011, No.6 fixing screws were used to secure the worktop.

If the rear panel is replaced on any Vented model made between October and December 2011, (serial numbers 11001.0000 to 11202.9999) 2xNo 8 fixing screws will also be required.
See parts List.

n4412c01: VENTED TUMBLE DRYER DRUM LIFTER

From Sept 2011, a curved drum lifter, has been used in production, the new lifter is fully interchangeable with the original straight drum lifter, once stock of the straight drum lifter is exhausted, the curved drum lifter will become the Service Spare, for all production dates”.

n4412i03: INTRODUCTION OF ARCADIA ELECTRONICS

STARTING FROM SEPTEMBER 2012 THE ARCADIA MODULE AND ASSOCIATED PARTS HAVE BEEN USED IN PRODUCTION.

PLEASE SELECT PARTS ACCORDING TO THE SERIAL NUMBER OF THE MACHINE

MOTORS ARCADIA PRODUCTION

2 ARCADIA PRODUCTION MOTORS HAVE BEEN USED IN PRODUCTION.

TYPE 377/8 CONNECTED BY A 3 WAY CONNECTOR

TYPE 387/8 CONNECTED BY 3 SEPARATE WIRES

n4412j01: ALWAYS USE THE CORRECT CAPACITOR

CAPACITORS

If a Capacitor is required the motor Type must be confirmed first.
THE CORRECT CAPACITOR MUST ALWAYS BE FITTED.

ANA IMEP 368	7uf Capacitor
WELLING 368	9uf Capacitor
WELLING 358	9uf Capacitor
ANA IMEP 358	9uf Capacitor

ARCADIA 377-378	9uf Capacitor
ARCADIA 387-388	9uf Capacitor

NOTE: The 9.5uF Capacitor is a direct replacement for the 9.0uF Capacitor

n4412l07: VENTED DRYER CONSOLE GRAPHIC CHANGES

IN A PHASED INTRODUCTION FROM NOVEMBER 2012, CONSOLE'S WITH B CLASS ASTHETICS HAS BEEN USED IN PRODUCTION.

DURING 2014 CERTAIN MODELS REVERTED BACK TO THE ORIGINAL CONSOLE

SELECT CORRECT PART REQUIRED FROM THE PARTS LIST

n4414a01: TUMBLE DRYER CAPACITORS

THE CORRECT SIZE CAPACITOR MUST ALWAYS BE USED.

377/378 MOTOR	9UF CAPACITOR
387/388 MOTOR	9UF CAPACITOR

n4414a02: ARCADIA TUMBLE DRYER VENTED MOTORS

TWO MOTORS HAVE BEEN USED IN PRODUCTION

MOTOR TYPE 377/378	(CONNECTS WITH A 3 WAY HARNESS BLOCK)
MOTOR TYPE 387/388	(CONNECTS WITH 3 SEPARATE WIRES)

VIEW LIST FOR CORRECT PARTS

n4414c04: VENTED AIR DUCT

A NEW VENTED AIR DUCT, FILTER AND DRUM FRONT SEAL WERE USED IN PRODUCTION BETWEEN 7th OCTOBER AND 16th OCTOBER 2013 (sn 31007.0000 to sn 31016.9999) DURING THESE DATES WHEN REQUIRING AN AIR DUCT, FILTER OR DRUM FRONT SEAL, PLEASE ORDER ALL 3 PARTS FROM THE PARTS LIST AND REPLACE ALL 3 PARTS. FOR ALL OTHER DATES ONLY THE PART WANTED WILL BE REQUIRED.

n4414f01: TUMBLE DRYER DRUM SHAFT FIXING KITS

THERE ARE 2 TUMBLE DRYER DRUM SHAFT KITS.

C00113038 DRUMS WHERE THE DRUM SHAFT IS SCREWED
C00305794 DRUMS WHERE THE DRUM SHAFT IS RIVETTED.
THE CORRECT KIT MUST ALWAYS BE FITTED.
BOTH KITS CONSIST OF THE DRUM SHAFT/SUPPORT, DRIVE PIN FIXING SCREWS and REAR BEARING.
STARTING FROM JUNE 2014 THE DRUM SEALS WHICH WERE INCLUDED IN KIT C00113038 HAVE BEEN REMOVED.

n4414h00: VENTED AIR DUCT-FILTER-FRONT SEAL-BEARING PADS

FROM JUNE 2011 THE FRONT AIR DUCT FITTED TO VENTED TUMBLE DRYERS CHANGED IN PRODUCTION FROM GREY TO WHITE.
ONCE STOCK OF THE GREY AIR DUCT IS EXHAUSTED, ONLY THE WHITE WILL BE THE SERVICE SPARE.

FROM JUNE 2014 IN A PHASED INTRODUCTION A NEW VENTED AIR DUCT, FILTER AND DRUM FRONT SEAL HAVE BEEN USED IN PRODUCTION.
THESE NEW PARTS ARE NOT INTERCHANGEABLE. SEE PARTS LIST

THE NEW AIR DUCT-FILTER-FRONT AXIAL SEAL-BEARING PADS WERE ALSO USED IN PRODUCTION BETWEEN 7th OCTOBER AND 16th OCTOBER 2013 (sn 31007.0000 to sn 31016.9999) ON THE MODELS LISTED BELOW.

IDVA735FR	cc 62967
IDV75FR	cc 62968
IDV75EU	cc 62978

n4414j02: NEW LED DISPLAY MODULE

TO STANDARDISE LED DISPLAY MODULES FROM SEPTEMBER 2014 A NEW LED DISPLAY MODULE HAS BEEN USED IN PRODUCTION.

n4415l01: VENTED REAR PANEL SERVICE KIT

Please see TB001652 for instruction.

n4416b07: Ventilés, tambour avec rivet 4mm

Si vous remplacez le tambour, il faut remplacer également le panneau arrière C00383247.

Ceci car sur le tambour (code C00383262) il y a un rivet de 4mm, qui ne se monte pas avec le panneau arrière présent sur ces produits.

n4416c00: VENTED REAR PANEL KIT

BEFORE REPLACING A REAR PANEL THESE CHECKS MUST BE CARRIED OUT

CONFIRM THE DRYER IS DISCONNECTED FROM THE ELECTRICAL SUPPLY

REMOVE THE LID OF THE DRYER

1. IF THE SERIAL NUMBER IS BEFORE 60606.0000 (6th JUNE 2006)

IF THE REAR OF THE DRUM IS FLAT REPLACE THE DRUM C00383262 AND REAR PANEL KIT C00383247.
(BOTH PARTS MUST BE REPLACED).

2. IF THE REAR OF THE DRUM IS PROFILED (NOT FLAT)

CAREFULLY ROTATE THE DRUM 1 COMPLETE REVOLUTION

IF "4 RIV" OR "4mm" IS PRINTED ON THE OUTSIDE OF THE DRUM FIT REAR PANEL KIT C00383247

IF "4 RIV" OR "4mm" IS NOT PRINTED ON THE OUTSIDE OF THE DRUM FIT REAR PANEL KIT C00379277

n4409k00: FRONT AIR DUCT & AIR DUCT SEAL

FRONT AIR DUCT SEAL

Both 14mm and 16mm Air Duct Seals have been used in production.

14 mm - used Before Serial No. 50501.0000 (May 2005) and After 00115.0001 (Jan 2010)

16 mm - used Between Serial No.s 50501.0001 (May 2005) and 00115.0000 (Jan 2010) - See note.

If replacing the Seal and the Original Air Duct is Fitted - select the CORRECT size from the parts list.

AIR DUCT

White Air Ducts were used in production from 10601.0000 (June 2011), the only difference to the Grey Ducts is the colour change.

WHITE AIR DUCTS ONLY will become the only Service Air Duct

If the original air duct is grey, the air duct kit is required which includes a white filter.

NOTE: If the serial number is between 31007.0000 and 31016.0000 read all relevant Notices

Before Serial Number 40701.0000 1st July 2014. If the AIR DUCT is being replaced you will require a 14mm Seal because the service replacement AIR DUCT is 14mm. See parts List

n4414a00: BUMP STOP

From the Autumn of 2013 2 Bump Stops were added to the rear panel.

n4416a00: SUITABLE REPLACEMENT

The 9uf capacitor has been superseded to the 9.5 capacitor this is a suitable replacement but if a 9.5 capacitor is already fitted then a 9uf capacitor should not be fitted.

Schémas électriques

Cod. 5407583

Indesit Company

INDESIT TUMBLE DRYER - LED FAULT CODES

Empty Water
Clean Filter
Clean Condenser
Dry
Cool Tumble
P.O.

LED 5
LED 4
LED 3
LED 2
LED 1

Fault Code LEDs

A fault is indicated by the Start/Pause and Option LEDs flashing - plus one or more of the Fault Code LEDs illuminated (but not flashing) together.

Note: The first 15 minutes of all automatic cycles is used to calculate the estimated drying time.

FAULT CODE TABLE

FAULT	CAUSE	STATUS OF LEDs - LED COMBINATION				
		5	4	3	2	1
F01	Motor triac in short circuit or Relay of motor welded closed	OFF	OFF	OFF	OFF	ON
F02	Blocked motor (fan blocked).	OFF	OFF	OFF	ON	OFF
F03	Front NTC open or short circuit	OFF	OFF	OFF	ON	ON
F04	Pump working when should be off.	OFF	OFF	ON	OFF	OFF
F05	Pump not working when should be on.	OFF	OFF	ON	OFF	ON
F06	Non used, active	OFF	OFF	ON	ON	OFF
F07	Lower element failure	OFF	OFF	ON	ON	ON
F08	Static heater relay welded closed	OFF	ON	OFF	OFF	OFF
F09	Error set-up file. EEPROM is not programmed or not functioning	OFF	ON	OFF	OFF	ON
F10	Common of heater open, one shot open	OFF	ON	OFF	ON	OFF
F11	Pump open circuit.	OFF	ON	OFF	ON	ON
F12	No communication between display board and control board	OFF	ON	ON	OFF	OFF
F13	Rear NTC open or short circuit.	OFF	ON	ON	OFF	ON
F14	Upper element failure	OFF	ON	ON	ON	OFF
F15	Dynamic (PD) heater relay welded closed	OFF	ON	ON	ON	ON
F16	Not used, active	ON	OFF	OFF	OFF	OFF
F17	Master relay welded closed	ON	OFF	OFF	OFF	ON

For additional Fault Code information see next page.

Service Manual UK

English

Doc. Ref: 5407583. Issue 1. Dec. 2010

1 of 2


Indesit Company	
DIAGNOSTIC NOTES - LED CONSOLE TUMBLE DRYERS	
Float Switch Operation The Tumble Dryer will continue to tumble and heat for 1 minute, and then tumble with no heat for a further 10 minutes. Therefore after float switch operation no warnings will display for upto 12 minutes.	
ONE SHOT Thermostat Operation Before Serial number 70802.0000, the relevant fault code will display.	
A1 Module Versions: Between serial numbers 70802.0001 and 91123.0000 (A1) the Tumble Dryer will "shut down", all LEDs and display are OFF.	
A2 Module Versions: From Serial number 00101.0000 (A2) the heater will turn off, but the programme will continue with normal drum operation, the Tumble Dryer will not dry.	
Between Serial Numbers 91123.0001 and 91231.9999 : - If Tumble Dryer has no blue dot on rear panel see A1 above - If Tumble Dryer has a blue dot on rear panel see A2 above.	
Service Manual UK	
English	
Doc. Ref: 5407583. Issue 1. Dec. 2010	
2 of 2	

Légende

Légende: 5407583

Schémas électriques

Cod. 5407589

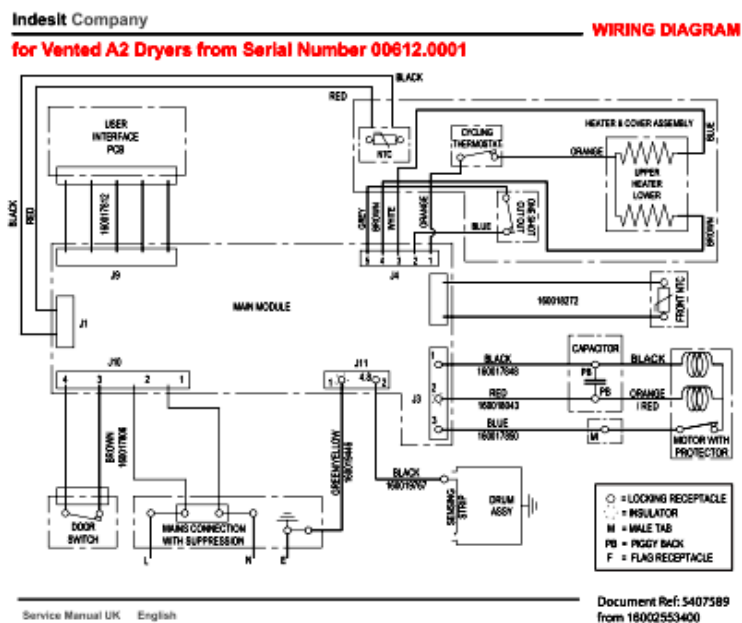


Légende

Légende: 5407589

Schémas électriques

Cod. 5407808

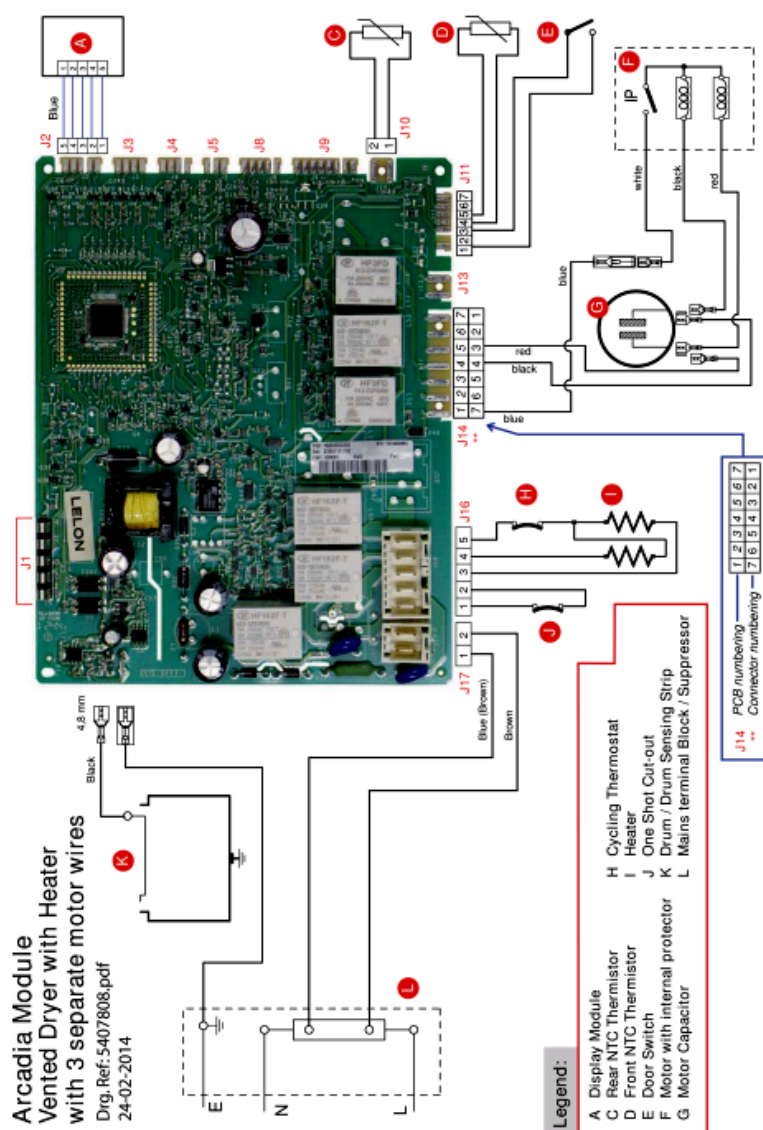


Légende

Légende: 5407808

Schémas électriques

Cod. 5407809

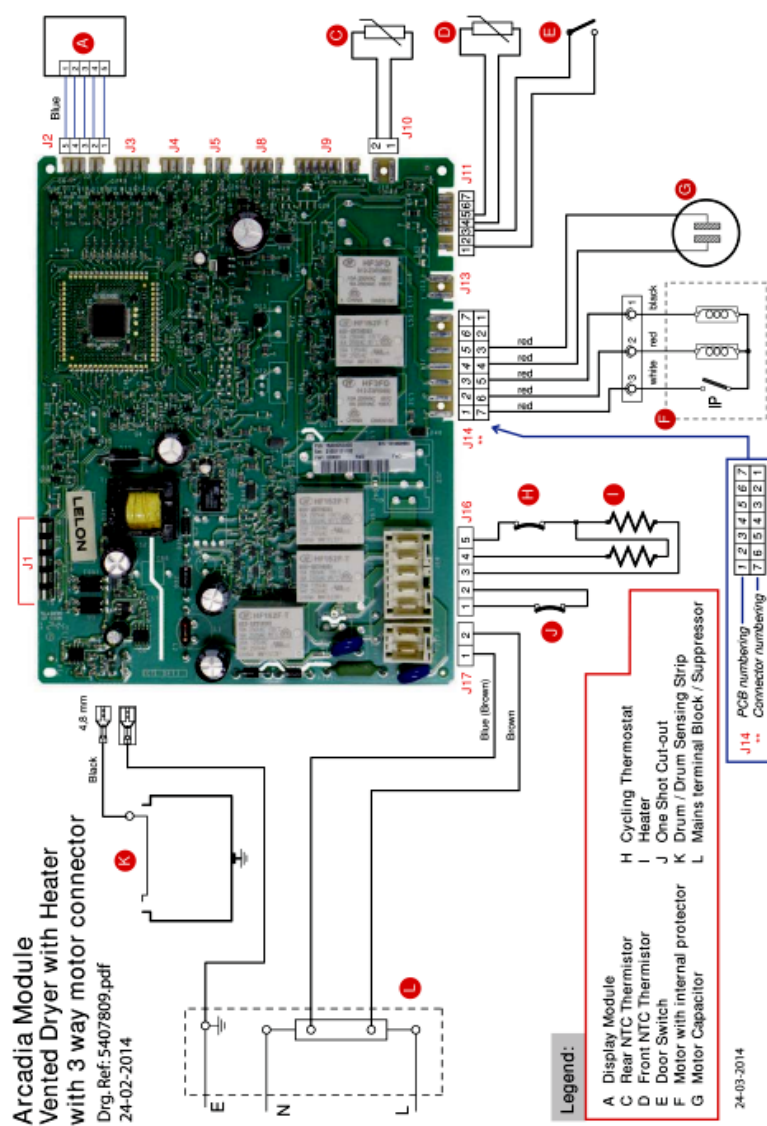

Légende

Légende: 5407809

Schémas électriques

Cod. 5407854

Indesit Company

ARCADIA FAULT CODES and DIAGNOSTICS

In the Event of a Fault the Options Indicators and Start/Pause LED will flash rapidly.
DSHFF module will show a fault code in the display in the format: Fxx. See page 3 for guidance on the fault cause.

VERTED - LED MODELS (Example)

All Option and Start/Pause LEDs will also flash

In the Event of a Fault the Options and Start/Pause LEDs will flash rapidly.
The fault Code can be identified by one vertical Led or a combination of the Vertical Led's being "ON". See the Table below. See page 3 for guidance on the fault cause.

FAULT CODE	LED 4	LED 3	LED 2	LED 1
F01	OFF	OFF	OFF	ON
F02	OFF	OFF	ON	OFF
F03	OFF	OFF	ON	ON
F04	OFF	ON	OFF	OFF
F05	OFF	ON	OFF	ON
F06	OFF	ON	ON	OFF
F07	OFF	ON	ON	ON
F08	ON	OFF	OFF	OFF
F09	ON	OFF	OFF	ON
F10	ON	OFF	ON	OFF
F11	ON	OFF	ON	ON
F12	ON	ON	OFF	OFF
F13	ON	ON	OFF	ON
F14	ON	ON	ON	OFF
F15	ON	ON	ON	ON

Service Manual UK

Doc. Ref: 5407854 / C0030321 / SMD04031 Page 1 of 3

Indesit Company

ARCADIA FAULT CODES and DIAGNOSTICS

CONDENSER LED Models

All Option and Start/Pause LEDs will also flash

In the Event of a Fault the Options and Start/Pause LEDs will flash rapidly.
The fault Code can be identified by one vertical Led or a combination of the Vertical Led's being "ON". See the Table below. See page 3 for guidance on the fault cause.

FAULT CODE	LED 4	LED 3	LED 2	LED 1
F01	OFF	OFF	OFF	OFF
F02	OFF	OFF	ON	OFF
F03	OFF	OFF	ON	ON
F04	OFF	OFF	ON	OFF
F05	OFF	OFF	ON	ON
F06	OFF	ON	OFF	OFF
F07	OFF	ON	ON	OFF
F08	OFF	ON	ON	ON
F09	ON	OFF	OFF	OFF
F10	ON	OFF	OFF	ON
F11	ON	ON	OFF	OFF
F12	ON	ON	ON	OFF
F13	ON	ON	ON	ON
F14	ON	ON	ON	OFF
F15	ON	ON	ON	ON
F16	ON	OFF	OFF	OFF
F17	ON	OFF	OFF	ON

Service Manual UK

Doc. Ref: 5407854 / C0030321 / SMD04031 Page 2 of 3

Indesit Company

FAULT CODES - QUICK GUIDE for Models fitted with an Arcadia Module

NOTE: This information ONLY a guide to possible solutions.

Other components (not mentioned here) or the way the product is used could also cause fault codes to be displayed. Filters and Vent hoses should always be checked for blockage.

Before investigating any Heating / Hot Heating or Temperature related faults, always check that the Cycling and One-Shot Thermostats are not Open Circuit (O/C). If the One-Shot Thermostat is O/C, it shows "O/C" codes in individual Fault Code. Not a temperature. Heating related fault code will be displayed.

F01	Water Circuit Fault	Check Motor and Motor Wiring and Connections, including relevant module edge connector. Check Door Switch and wiring and Connections. C and P Pump Module: Check heater and heater circuit including Cycling Stop, and attached connections including the relevant module connections. Heat Pump Module: Check Compressor and wiring and connections.
F02	Water Fault - Open or Short Circuit	Check Motor and Motor Wiring and Connections, including relevant module edge connector.
F03	Room RTC	Check Room RTC and attached wiring and module connections including relevant module connections. Check for repeat wiring before the air duct.
F04	Room RTC	No rise in temperature detected. Check Heater circuit including Cycling Thermostat, One-Shot Thermostat, heater and wiring. Also check Room RTC (heater) - Open or Short Circuit. Check Room RTC (heater) - heater (Pump) and attached wiring and module connections including relevant module connections.
F05	Heat Pump Refrigerant O/C open or short circuit	Heat Pump Module only. Check RTC, attached to the refrigerant circuit. Check attached wiring and module connections including relevant module connections.
F07	Compressor - Open or Short Circuit	Heat Pump Module only. Test the Compressor. Capacitor, and attached wiring and connections including the relevant edge connector.
F08	Heater - Open or Short Circuit	C and P Pump Module: Test heater and heater circuit including the Cycling Stop. Heat Pump Module: Check the Heat Pump (pump) (the Pump) is clean and the heating is not blocked with full.
F09	Fan Setting Corrupted	Reset the setting between the Display and Power Modules.
F10	Room RTC Overheating	Check the Refrigerant Flow is Open. Check the machine as per flow for blockage. Check the machine Flow and air vents are not restricted or blocked. Check the RTC and attached Circuit and Connections. Heat Pump Module: Check the Heat Pump (pump) (the Pump) is clean and the heating is not blocked with full.
F14	Room RTC Over Heating	Check the Cycling Thermostat is operating correctly. Check the Refrigerant Flow is Open. Check the machine as per flow for blockage. Check the machine Flow and air vents are not restricted or blocked. Check the RTC and attached Circuit and Connections.
F15	Room RTC Overheating (Refrigerant Circuit)	Heat Pump Module only. Check RTC, attached to the refrigerant circuit. Check attached wiring and module connections including relevant module connections.
F16	RFW Communication	Check RFW module pin wiring and connections between the module and module.

Service Manual UK

Doc. Ref: 5407854 / C0030321 / SMD04031 Page 3 of 3

Légende

Légende: 5407854